DIST =- RANLO DP SE SSE SER AGR FILE (30/4/42)

Declassified by ASD - 10/05/2022 Information removed for national security and/or personal sensitivities

42

4

30

36

ZNY MMNSH R Ø1Ø4Ø4Z OCT 8Ø

FM DSD

TO

RR

RR

DE

INFO DEFNAV CANBERRA ZEM

CONFIDENTIAL COMINT CHANNELS

£0049 2750405

DEFNAL	FOR	DCPD
AIKEN	MULT	ICOUPLER
REFS:	Α.	1003502 AUG 79 - F 31
	В.	DSD 150920Z MAY 80 - F 32
	с.	120711Z SEP 80 - F 34

1. VIDE REF A AN AIKEN MULTICOUPLER WAS FORWARDED FOR INVESTIGATION OF SECOND ORDER INTERMODULATION PERFORMANCE. REF B ADVISED THAT DUE TO OTHER WORK COMMITMENTS, IT WAS NOT POSSIBLE TO CONDUCT TESTS. REF C REQUESTS CURRENT STATUS OF INVESTIGATION.

2. A PRELIMINARY INVESTIGATION HAS REVEALED THAT THE MULTICOUPLER IS UNSERVICEABLE. UNSERVICEABILITIES FOUND INCLUDE FAULTY POWER SUPPLY, TWO OF THE FOUR DISTRIBUTION AMPLIFIERS ARE FAULTY AND A TRANSISTOR IS MISSING FROM ONE OF THE DISTRIBUTION AMPLIFIERS. CONCENSUS IS THAT MULTICOUPLER PROBLEM IS PROBABLY DUE TO FAULTY OR MISMATCHED TRANSISTORS. REPAIR OF THE MULTICOUPLER WAS CONSIDERED BUT HAS BEEN DISCOUNTED BECAUSE NO HANDBOOKS OR SPARE TRANSISTORS ARE HELD, LEADTIME TO OBTAIN TRANSISTORS IS QUOTED AT 12 WEEKS ARO AND, ON PRESUMPTION THAT TRANSISTORS SHOULD BE DYNAMICALLY MATCHED, REASONABLE QUANTITIES (10-12) OF TYPES 2N5161 AND 2N5090 WOULD BE NEEDED AT UNIT COSTS OF \$10.94 AND \$12.31 RESPECTIVELY. IN THE CIRCUMSTANCES, IT WAS CONSIDERED UNWISE TO ATTEMPT REPAIRS WHICH WOULD NECESSARILY INCUR FURTHER LENGTHY DELAYS. THEREFORE ARRANGEMENTS ARE NOW BEING MADE TO RETURN THE MULTICOUPLER.

3. SUGGEST THAT INVESTIGATION OF THE MULTICOUPLER PERFORMANCE BE DEFERRED UNTIL NECESSARY DSD TECHNICAL EFFORT IS AVAILABLE (WHICH WILL BE SOME TIME OFF) OR ALTERNATIVELY YOU MAY. WISH TO CONSIDER OTHER ARRANGEMENTS. PLEASE NOTE THAT SPECIAL TEST ARRANGEMENTS ARE NECESSAY TO INVESTIGATE INTERMODULATION PROBLEMS IN DEPTH BECAUSE OF THE DISTORTION PRODUCTS USUALLY PRESENT IN THE OUTPUT OF SIGNAL GENERATORS. £0849